

Installation process – StreetMark

Required tools and materials:


- Thermoplastic material, gas burner plus propane tank, markers and chalk for marking, protective gloves and goggles, infrared thermometer, sweeping brush or blower.

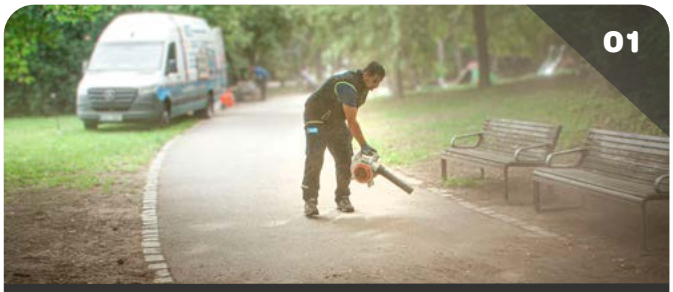


Ensure that the asphalt surface is clean, dry, and free of debris. The surface must be free of oils or other chemicals.

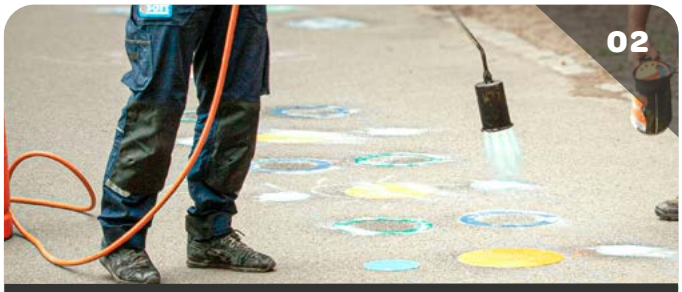


Always warm up the surface before application. This is especially important at lower temperatures, but also in summer, to remove any remaining moisture.

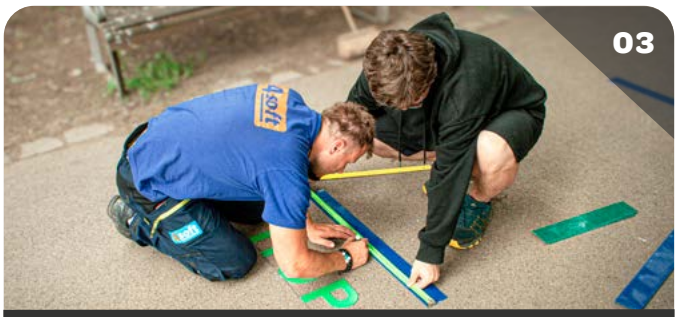

Draw auxiliary lines and marks on the substrate according to the enclosed installation drawing.

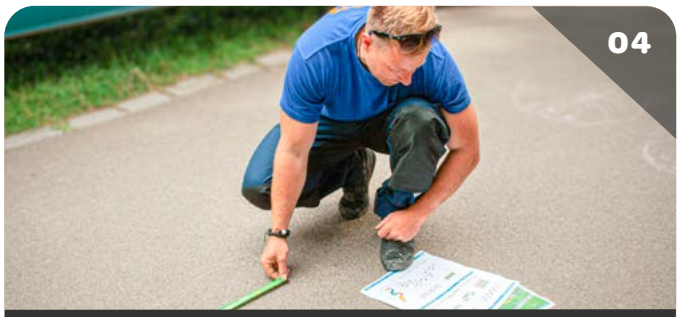

Assemble the individual parts of the graphics according to the manufacturer's instructions.

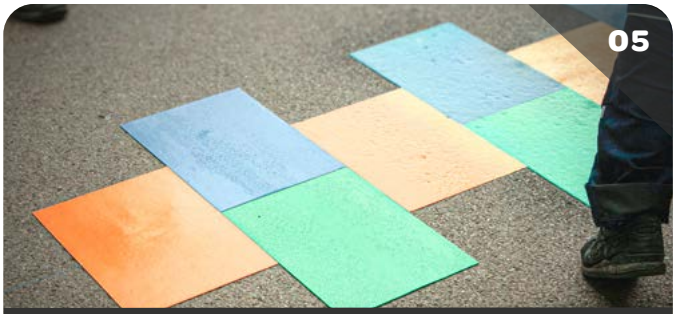

Then heat the material over the entire surface until it is completely melted and adheres to the substrate.



For thorough adhesion, the molten material must reach a temperature between 200 and 220 °C. Check the temperature with an infrared thermometer.



Immediately after melting, sprinkle glass beads onto the still-hot surface of the material. Distribute evenly using a hand-held sprinkler.



Wait 20–30 minutes until the material has cooled completely. Sweep up any remaining glass beads.

Contact:
4soft s.r.o.
Krkonošská 625
468 41 Tanvald, CZ
mob: +420 605 163 929
e-mail: info@4soft.cz
Company ID: 28703324,
VAT ID: CZ28703324
4soft
www.streetmark.eu